DEKRA

True View Inspection

Report No: 2017320994
Date: 03/11/2026





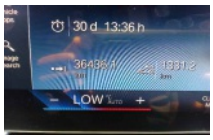



Assignment

Requested Date:	03/11/2026	**Inspection Location:**	DEKRA Marlboro Park LEES STREET - 2090 malboro - GT
Inspection Date:	03/11/2026		

Vehicle Data

Vehicle Type:	PASSENGER VEHICLE	**Reg No:**	HGB171L
Manufacturer:	BMW	**Register No:**	FZD160X
Model:	X1 XLINE SDRIVE18D DSL SAV STEPTRONIC [2022-ON]	**First Licensing:**	
		Fuel:	DIESEL
VIN:	WBA12EG0905X26618	**Odometer:**	36,436 KM
Engine No:	61837190		

Exhaust System

Brakes

Axle	Left Braking Force [KN]	Right Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.46	2.57	-	
Rear	1.82	1.8	-	
Emergency / Parking	1.79	1.83	-	

Tyres

Position	Size	Load/Speed Index	Manufacturer	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/45R20	102Y	Pirelli	Pzero	V	1823	2
Front Right	245/45R19	102Y	Pirelli	Pzero	V	1923	2
Rear Left	245/45R19	98Y	Pirelli	Pzero	V	2922	3
Rear Right	245/45R19	102Y	Pirelli	Pzero	V	1723	3
Spare	T135/80R17	103M	Maxxis	Temporary	V	0723	2

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
2	BCP	8011A	VEHICLE INTERIOR COOLING LIMITED / NOT AVAILABLE.	PERMANENT

No	System	Code	Description	Status
3	BCP	80402F	POWER MANAGEMENT, BATTERY CONDITION: TOTAL DISCHARGE	PERMANENT

Axles & Undercarriage

Electrical Systems

Engine & Transmission

Exterior & Interior

Inspection Conditions

Engine number not visible without dismantling. Inspection conditions were sufficient.

Engine number â€“ not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

General Comments

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.

Disclaimer

The DEKRA True View Inspection is a visual and functional check of listed items. Concealed/hidden defects are not covered. DEKRA does not dismantle or strip parts. Road testing is limited. Valid only for the vehicle and condition at inspection time. DEKRA T&Cs apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave, Klerksoord, Pretoria, 0200
Phone: 012 542 4867 | www.dekraauto.co.za

VIN: WBA12EG0905X26618