# True View Inspection

**Report No:** 2017316587
**Date:** 23/10/2026





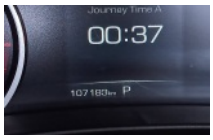



## Assignment

| | | | |
|---|---|---|---|
| **Requested Date:** | 23/10/2026 | **Inspection Location:** | DEKRA N1 City<br>Cnr Louwtjie Rothman & Manus<br>Gerber - 7463<br>N1 City - WC |
| **Inspection Date:** | 23/10/2026 | | |

## Vehicle Data

| | | | |
|---|---|---|---|
| **Vehicle Type:** | PASSENGER VEHICLE | **Reg No:** | CY170166 |
| **Manufacturer:** | HAVAL | **Register No:** | JLS659L |
| **Model:** | JOLION 1.5T PREMIUM 7-SP DCT [2021-2024] | **First Licensing:** | |
| | | **Fuel:** | PETROL |
| **VIN:** | LGWEE4A52NK620974 | **Odometer:** | 107,183 KM |
| **Engine No:** | 22299064974 | | |

## Exhaust System

## Brakes

| Axle | Left Braking Force [KN] | Right Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s²] |
|---|---|---|---|---|
| **Front** | 3.3 | 3.9 | - | |
| **Rear** | 1.8 | 2.1 | - | |
| **Emergency / Parking** | 1.8 | 2.1 | - | |

## Tyres

| Position | Size | Load/Speed Index | Manufacturer | Model | Type* | Production Date | Tread Depth (mm) |
|---|---|---|---|---|---|---|---|
| **Front Left** | 215/60R17 | 96h | BRIDGESTONE | ALENZA | V | 3725 | 4 |
| **Front Right** | 215/60R17 | 96h | BRIDGESTONE | ALENZA | V | 3625 | 4 |
| **Rear Left** | 215/60R17 | 96h | BRIDGESTONE | ALENZA | V | 3725 | 4 |
| **Rear Right** | 215/60R17 | 96h | BRIDGESTONE | ALENZA | V | 3625 | 4 |
| **Spare** | 135/90R17 | 104m | SAILUN | temp | V | 0000 | 3 |

## Diagnostic

A vehicle diagnostic has not been conducted.
Diagnostic could not be performed due to no data available and or OBD interface malfunction.

## Axles & Undercarriage



**Ball Joint(s):** Right - Noisy.
**Repair Way:** Roadworthy Relevant

## Electrical Systems

## Engine & Transmission

## Exterior & Interior



**Seat Belt Stalk:** Left Right - Loose / Excessive Play.
**Repair Way:** Roadworthy Relevant

## Inspection Conditions

Engine number not visible without dismantling. Inspection conditions were sufficient.

Vehicle Dirty

Engine number â€“ not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

## General Comments

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR, INTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

## Disclaimer

The DEKRA True View Inspection is a visual and functional check of listed items. Concealed/hidden defects are not covered. DEKRA does not dismantle or strip parts. Road testing is limited. Valid only for the vehicle and condition at inspection time. DEKRA T&Cs apply.

**DEKRA Automotive (PTY) Ltd.**
97 Willem Cruywagen Ave, Klerksoord, Pretoria, 0200
Phone: 012 542 4867 | www.dekraauto.co.za

VIN: LGWEE4A52NK620974