# True View Inspection

**Report No:** 2017325493
**Date:** 13/11/2026




## Assignment

| | | | |
|---|---|---|---|
| **Requested Date:** | 13/11/2026 | **Inspection Location:** | DEKRA Randburg<br>114 BORDEAUX DRIVE - 2194<br>Randburg - |
| **Inspection Date:** | 13/11/2026 | | |

## Vehicle Data

| | | | |
|---|---|---|---|
| **Vehicle Type:** | PASSENGER VEHICLE | **Reg No:** | ML41JJGP |
| **Manufacturer:** | BMW | **Register No:** | HNY674X |
| **Model:** | 218 GRAN COUPE STEPTRONIC [2025-ON] | **First Licensing:** | |
| | | **Fuel:** | PETROL |
| **VIN:** | WBA12GG0007S78852 | **Odometer:** | 23,103 KM |
| **Engine No:** | 34217801 | | |

## Exhaust System

## Brakes

| Axle | Left Braking Force [KN] | Right Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s²] |
|---|---|---|---|---|
| **Front** | 3.4 | 3.5 | - | |
| **Rear** | 1.9 | 2.1 | - | |
| **Emergency / Parking** | 1.4 | 1.5 | - | |

## Tyres

| Position | Size | Load/Speed Index | Manufacturer | Model | Type* | Production Date | Tread Depth (mm) |
|---|---|---|---|---|---|---|---|
| **Front Left** | 225/45R18 | 95Y | Hankook | Ventus S1 | V | 04/25 | 1 |
| **Front Right** | 225/45R18 | 95Y | Hankook | Ventus S1 | V | 05/25 | 1 |
| **Rear Left** | 225/45R18 | 95Y | Hankook | Ventus S1 | V | 04/25 | 4 |
| **Rear Right** | 225/45R18 | 95Y | Hankook | Ventus S1 | V | 05/25 | 4 |

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code | Description | Status |
|---|---|---|---|---|
| 2 | FLER(FRONT LIGHT ELECTRONICS LEFT) | DA3406 | NO MESSAGE (EFFICIENT MODE CONFIGURATION); RECEIVER FLEL, TRANSMITTER KOMBI/MGU | PERMANENT |

| No | System | Code | Description | Status |
|---|---|---|---|---|
| 3 | SAMM(FRONT SMARTPHONE TRAY MODULE) | 8056C5 | SAMM: TEMPORARY FUNCTIONAL LIMITATION: FOREIGN BODY DETECTED | PERMANENT |

## Axles & Undercarriage

## Electrical Systems

## Engine & Transmission

## Exterior & Interior

## General Photos



1. Front right corner



2. Rear left corner



3. Interior (Front driver door)

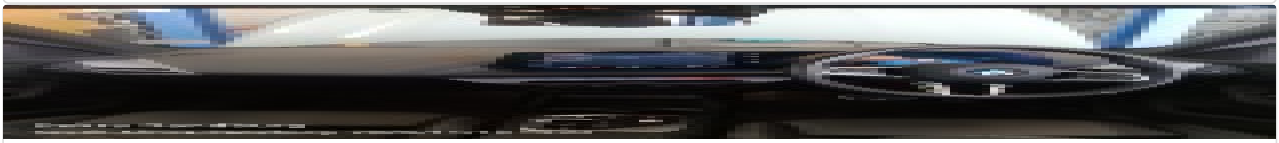

4. Dashboard (Taken from the rear seat)



5. Cluster (While engine is running)



6. Odometer



7. License disc




8. VIN plate/sticker



9. Front



10. Right



11. Rear



12. Left

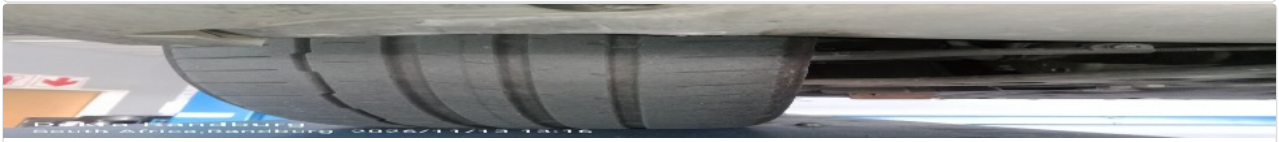

13. Front left tyre tread



14. Rear left tyre tread



15. Rear right tyre tread



16. Front right tyre tread



17. Engine compartment

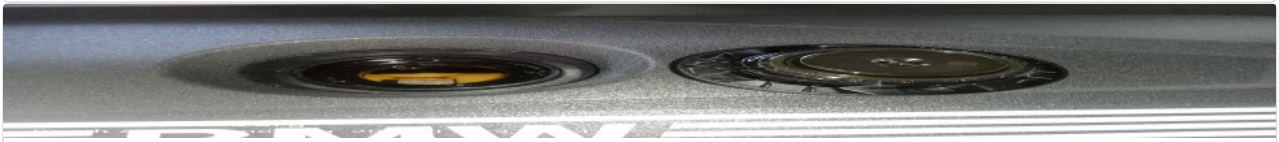

18. Oil cap and dip stick

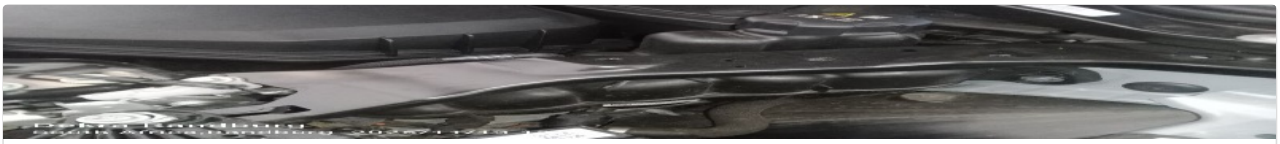

19. Expansion bottle/Coolant level



20. Engine bottom



21. Chassis front

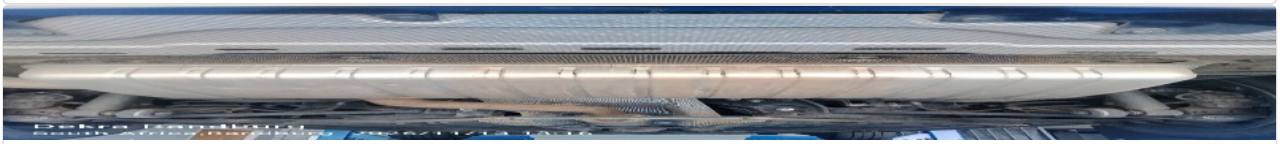

22. Chassis rear

## Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

## General Comments

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR, INTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

## Disclaimer

The DEKRA True View Inspection is a visual and functional check of listed items. Concealed/hidden defects are not covered. DEKRA does not dismantle or strip parts. Road testing is limited. Valid only for the vehicle and condition at inspection time. DEKRA T&Cs apply.

**DEKRA Automotive (PTY) Ltd.**
97 Willem Cruywagen Ave, Klerksoord, Pretoria, 0200
Phone: 012 542 4867 | www.dekraauto.co.za

VIN: WBA12GG0007S78852