DEKRA

True View Inspection

Report No: 2017329203
Date: 23/11/2026



Assignment

Requested Date:	23/11/2026	**Inspection Location:**	Midrand Midrand Motor City, Old Pretoria Road - 1682 Midrand - GT
Inspection Date:	23/11/2026		

Vehicle Data

Vehicle Type:	PASSENGER VEHICLE	**Reg No:**	MV19HYGP
Manufacturer:	TOYOTA	**Register No:**	KWH114L
Model:	COROLLA CROSS 1.8 XR CVT [2025-2026]	**First Licensing:**	
		Fuel:	PETROL
VIN:	AHTKFBAG700663597	**Odometer:**	16,208 KM
Engine No:	2ZR6H79149		

Exhaust System

Brakes

Axle	Left Braking Force [KN]	Right Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.8	3.0	-	
Rear	2.4	2.5	-	
Emergency / Parking	1.1	1.3	-	

Tyres

Position	Size	Load/Speed Index	Manufacturer	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R18	95v	Bridgestone	Alenza	V	2725	3
Front Right	225/50R18	95v	Bridgestone	Alenza	V	2725	3
Rear Left	225/50R18	95v	Bridgestone	Alenza	V	2725	3
Rear Right	225/50R18	95v	Bridgestone	Alenza	V	2725	3
Spare	155/70R17	110m	Dunlop	Temporary		7328	3

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
2	BRAKES	C137BA3	- BRAKE MODULE VOLTAGE HIGH	CONFIRMED

Axles & Undercarriage

Electrical Systems

Engine & Transmission

Exterior & Interior

General Photos



1. Front right corner

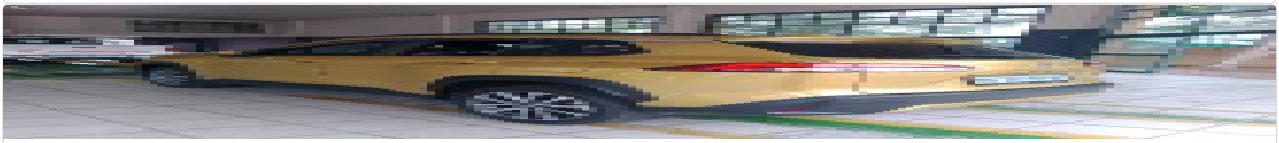

2. Rear left corner



3. Interior (Front driver door)

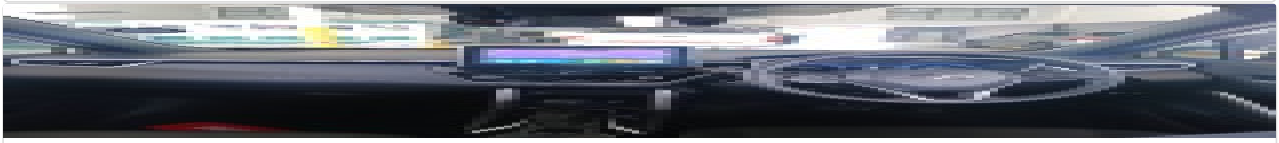

4. Dashboard (Taken from the rear seat)



5. Cluster (While engine is running)



6. Odometer



7. License disc



8. VIN plate/sticker



9. Front



10. Right



11. Rear



12. Left



13. Front left tyre tread



14. Rear left tyre tread

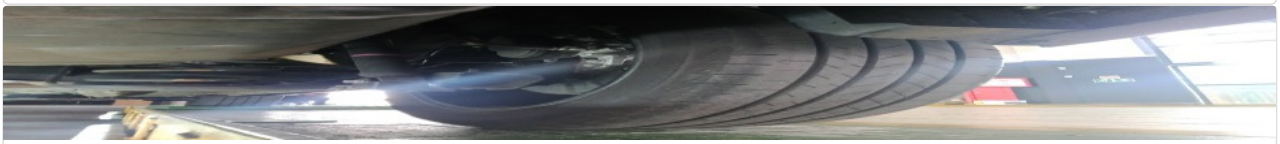

15. Rear right tyre tread



16. Front right tyre tread

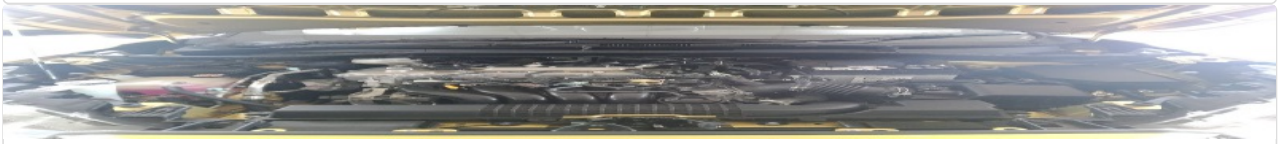

17. Engine compartment



18. Oil cap and dip stick



19. Expansion bottle/Coolant level



20. Engine bottom



21. Chassis front



22. Chassis rear

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient

General Comments

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.

Disclaimer

The DEKRA True View Inspection is a visual and functional check of listed items. Concealed/hidden defects are not covered. DEKRA does not dismantle or strip parts. Road testing is limited. Valid only for the vehicle and condition at inspection time. DEKRA T&Cs apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave, Klerksoord, Pretoria, 0200
Phone: 012 542 4867 | www.dekraauto.co.za

VIN: AHTKFBAG700663597